

---

## **Circuit Change**

---

***PROBLEM:** The standby transformer voltage is dropping or unit won't turn on from standby mode.*

---

***CAUSE:** Capacitors C511,C512 and C513 are shorting.*

---

***SOLUTION:** Change C511,C512 and C513 from 100nF/100v ceramic disc to 100nF/100v metallized polyester film.*

---

### ***PRODUCTION:***

This change has been implemented in production from serial number:H1YC35017612

---

### **Contact:**

**NAD Electronics International**  
**633 Granite Court**  
**Pickering, ON Canada L1K 3K1**  
**Voice: 905-831-0799 FAX 905-837-6357**  
**[www.nadelectronics.com](http://www.nadelectronics.com)**